
3M[™] Through-Board Socket

2.54 mm x 2.54 mm, Straight, Solder Tail

966 Series

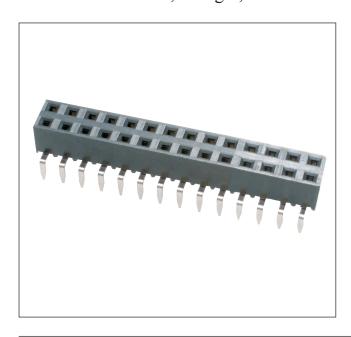

- High temperature dielectric
- "No lead" wave and reflow solder compatible
- Dual row design, 4-72 pins
- Dual entry version
- Mates with pin-strip header products
- RoHS Compliant. See the Regulatory Information Appendix (RIA) in the RoHS compliance section of www.3Mconnectors.com for compliancainformation (RIA E1 & C1 apply)

TS-2193-C Date Modified: Novemb Sheet 1 of 2

Physical

Insulation

Material: High Temperature Thermoplastic

Flammability: UL 94V-0 Color: Black

Contact

Material: Copper Alloy

Plating

Underplating: 1.25–2.5 μm [5]

Wiping Area: Flash Gold

Matte Tin Solder Tail Area: 1–3 µm

Electrical

Current Rati

 $5 \times 10^{8} \text{ Ohm at } 100 \text{ V}_{DC}$ **Insulation Resist**

 $1000 V_{DC}$ Withstandi

Environmental


-25 °C to +105 °C Temperature Range:


Processing Temperature: max. 260 °C (Profile per J-STD-020C)

Moisture Sensitivity Level: 1 (per J-STD-020C)

UL File No.: E68080

2.54 mm and 2.54 mm x 2.54 mm, Straight, Solder Tail

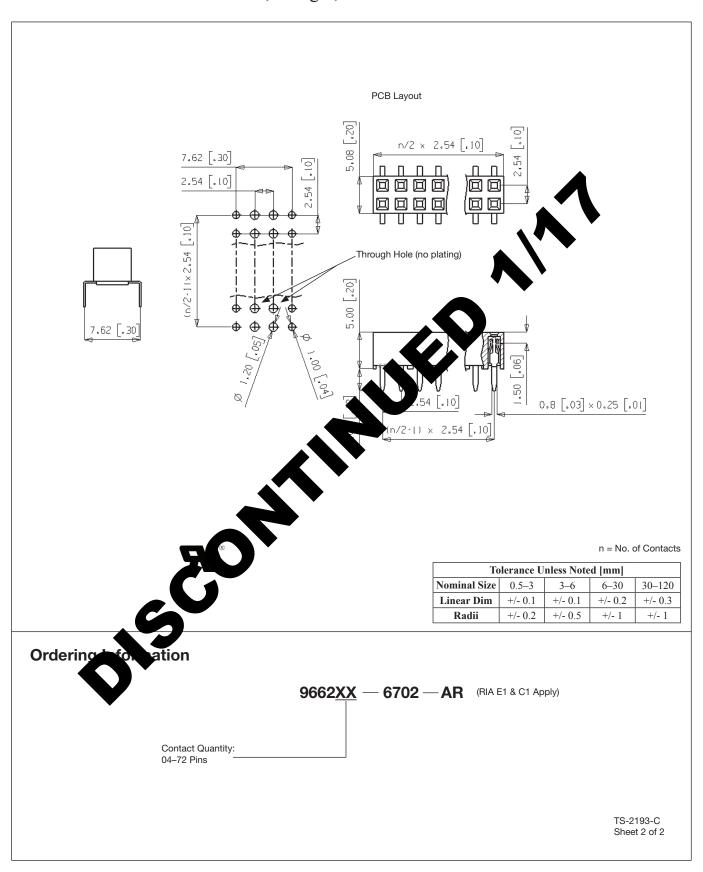

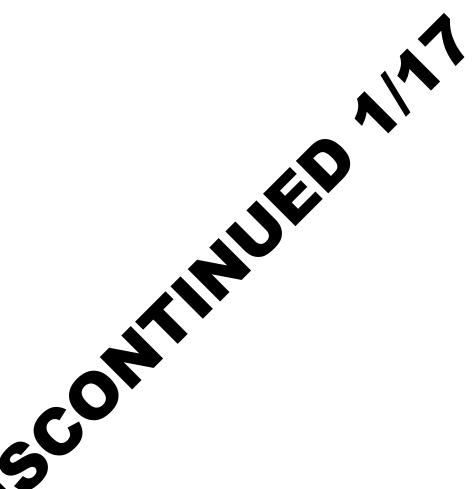

Important Notice

All statements, technical in the acturacy or completeness is not guaranteed. Before asing, is product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements of the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effective as sexpressly agreed upon, in writing, by an authorized officer of 3M.

Warranty: Limited Remedy: Limited Liability.

This product will be free from defects in material and manufacture for a period of ninety (90) days from the time of purchase. 3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.



3M Electronics Solutions Division

6801 River Place Blvd. Austin, TX 78726-9000 U.S.A. 1-800-225-5373 www.3Mconnectors.com